


Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

# Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	350 SKIDTUBE ASSEMBLY LH
Job Number :	39656	Part Number :	D350636011
Estimate Number :	10262	Drawing Number :	D2750 UNDER REVIEW
P.O. Number :		Project Number :	N/A MFG. PER DSE 9413 07.06.04
This Issue :	04/06/2008 S.O. No. :	Drawing Revision :	E
Prsht Rev. :	NC	Material :	
First Issue :	02/06/2008 Type : SKIDTUBES	Due Date :	15/06/2008
Previous Run :	39655	Qty:	1 Um: Each
Written By :			
Checked & Approved By :			
Comment :	Est Rev:I 02.09.25 Rearranged procedure steps KJ Est Rev:J 06-03-23 As per Rev D JLM Est Rev:K 06-07.13 As per dsi9343 EC Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM Verified By:EC Est Rev:M 08-04-22 update steps 4, 13 DD verified by:EC		

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



*S. Lacelle*



JLD  
08.6.10

Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-011 CHG 003 MFG. PER DSE 9413 07.06.04

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

38463

SL 8-65

3.0 D2744 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch

37768

BE

08/06/05

4.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details).Drill using drill Jig DT8150 & DT8863.

SL 8-65

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

4-Drill pilot holes for Detail G using DT8330

5-Open up holes for Detail B to 0.375" (4 holes per side) and blade fitting location holes to 0.500" (total of 5 holes per side) as per dwg D2750. Open up holes for ground handling and detail E to 0.500" (8 holes per side)

6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108

\*\*\*\*Make sure that wearplate holes are on bottom of tube\*\*\*\*\* Open 4 aft wearplate holes to 0.250". Open remaining wearplate holes to 0.297"

7-Open up holes of Detail A to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004  
A/R Aluminum Rod *M107877 BE 08/06/05*

10-Grind welds flush as per Dwg D2750 *BE 08/06/05*

12- Scribe batch# inside per dwg D2750 *BE 08/06/05*

5.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS



6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP



7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1



Chemical Conversion Coat as per QSI 005 4.1

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION



W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM.  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

B-39491

AWM 8-6-9

10.0

D34901

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B39600

BE 8-6-10

11.0

D34903

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B33825

BE 8-6-10

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch:

B37767

BE 8-6-10

13.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail E and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750.

2-Open up holes of Detail B to 0.750" (total of 4 holes per side) as per dwg D2750.

3- Open float hole to 0.500" (4 per side)

4-Chamfer holes of Detail B, E, ground handling and float holes per dwg D2750 (welding instructions on sheet 4)

5-Deburr and blow out all chips from inside of tube

6- Prepare tube for welding, remove alodine as required.

AWM  
8-6-9

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7-Bond web D2739 in place as per QSI 015

A/R Sikaflex-291

batch: M107-804

exp. date: 8-10-01

8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004

(welding instructions on sheet 4)

A/R Aluminum Rod

batch: M107877 BE 8-6-10

9-Grind welds flush as per Dwg D2750

10-Spot face ground handling holes section P-P (total of 4 places per side) as per dwg D2750

11-Deburr holes

-AWM  
8-6-11

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

5 08/06/12 (X)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 08/06/12 (X)

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M. 08/06/17

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

1:30

OVEN TEMPERATURE:

3:15

FINISH TIME:

2:00

FL/R17

(1X) 08/06/17

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

08-06-23 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

ALS41032225

Insert



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Insert

Batch: 11100489- JH

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install inserts as per Dwg D2750

JH

08-06-23

(K1)

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: B39587 JH

22.0

D353525

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B39716 JH

23.0

D353625

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B39234 JH

24.0

D35371

Wearpad



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

WEARPAD

Batch: B37749 JH

25.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate B39418

JH

08-06-23

(K1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

1339715

41

27.0

D37933

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

1339812

41

28.0

D37941

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

1339421

41

29.0

D37943

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

1339422

22

30.0

D36721

Phenolic Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Phenolic Washer

1339275

41

31.0

AN526C1032R10

Screw



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Screw

M108062

41

32.0

AN526C1032R18

Screw



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Screw

M108079

41

33.0

D36311

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

WASHER

Batch: 1338139

41

08-06-23

20

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

D3488041

Blade Fitting Assembly, LH



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade Fitting, LH

Batch: 1338786

91

35.0

D3492041

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1339676

91

36.0

D3492043

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: (6x) => 1339677 (2x) => 1339601

91

37.0

AN3C5A

Bolt



Comment: Qty.: 34.0000 Each(s)/Unit Total: 34.0000 Each(s)

Bolt

Batch: M108077

91

38.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M105300

91

39.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

BOLT

Batch: M108284

91

40.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

BOLT

Batch: M106896

91

08-06-23

(X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

41.0

AN960C10L

washer



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

washer

Batch: M1108077

HL

42.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M1107520

HL

43.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M1108255

HL

44.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M1108255

HL

45.0

NAS1515H3L

WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

WASHER

Batch: M1107394

HL

46.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: N/A

HL

47.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch: M1106096

HL 08.06.23 HL

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Wednesday, 04/06/2008 1:05:57 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M107893

EXP DATE: 08/10

4-Coat all exposed fasteners with "LPS Procyon" batch: M1041251

08-06-22 (initials)

48.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/06/03 (initials)

49.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

50.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade

Batch: 36343

SP

51.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: 107924

SP

52.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: 107520

SP

53.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 107587

8/6/23

SP

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 04/06/2008 1:05:58 PM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 39656

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

54.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch: 108255

scf

55.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 38757

scf

56.0

D35321

Spacer



Comment: Qty.: 2.0000 (s)/Unit Total : 2.0000 (s)

batch: 38161

8/6/23

1x

scf

57.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

08/06/24 TC

1x

scf

58.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-011

Rev G

CHG 004 08.06.04

8/6/24

1x

scf

59.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/06/26

Job Completion



MF 08-06-25

B39656

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

FOR D350-636-011/-012/-013/-014 SKIDTUBES AT CHG 004, AMEND PARTS LIST OF IIN-D350-636 SECTION 5 AS FOLLOWS:

REMOVE:

Item	Qty -011	Qty -012	Qty -013	Qty -014	Part Number	Description
	X				D350-636-011	SKIDTUBE INSTALLATION, LH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
		X			D350-636-012	SKIDTUBE INSTALLATION, RH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
			X		D350-636-013	SKIDTUBE INSTALLATION, LH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
				X	D350-636-014	SKIDTUBE INSTALLATION, RH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
*6A	1	1	1	1	AN960C816L	WASHER
6B	2	2	2	2	NAS1515H8L	WASHER
*22	2	2	2	2	D3537-1	WEARPAD
23A	1	1	1	1	D3535-13	WEARSHOE
23B	1	1	1	1	D3536-13	GASKET
25A	1	1	1	1	D3535-35	WEARSHOE
25B	1	1	1	1	D3536-35	GASKET
*26A	4	4	4	4	AN3C5A	BOLT
*26B	4	4	4	4	AN3C7A	BOLT
*27	8	8	8	8	AN960C10L	WASHER

\*SUBTRACT FROM TOTAL QUANTITY OF PARTS INDICATED IN INSTALLATION INSTRUCTIONS IIN-D350-636

ADD:

Qty -011	Qty -012	Qty -013	Qty -014	Part Number	Description
X				D350-636-011	SKIDTUBE INSTALLATION, LH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
	X			D350-636-012	SKIDTUBE INSTALLATION, RH, STD AERAZUR/APICAL CYLINDRICAL FLOAT COMPATIBLE
		X		D350-636-013	SKIDTUBE INSTALLATION, LH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
			X	D350-636-014	SKIDTUBE INSTALLATION, RH AIRCRUISER/ APICAL TRI-BAG FLOAT COMPATIBLE
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
8	8	8	8	D3672-1	WASHER
4	4	4	4	AN526C1032R10	SCREW
4	4	4	4	AN526C1032R18	SCREW

REFERENCE ONLY

Wls39656

DESIGN	PH	<b>DART AEROSPACE USA, INC</b> PORT HADLOCK, WA	
DRAWN	PH		
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9413	SHEET 2 OF 3
APPROVED		TITLE	SCALE
DE APPR.		WEARSHOE MODIFICATION	NTS
DATE	08.05.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

REFERENCE ONLY

# DART SERVICE INSTRUCTION


TO AMEND INSTALLATION INSTRUCTIONS IIN-D350-636 REV E

REF FAA STC: SR00646SE


REF CANADIAN STC: SH99-7

THE WEARPLATES ON D350-636-011/-012/-013/-014 SKIDTUBES AT CHG 004 (AND LATER) HAVE BEEN MODIFIED AS SHOWN IN FIGURE 1 BELOW TO ELIMINATE THE POSSIBILITY OF INTERFERENCE BETWEEN THE WEARPLATES AND CROSSTUBE SADDLES AT INSTALLATION. THERE IS NEGLIGIBLE WEIGHT CHANGE ASSOCIATED WITH THIS MODIFICATION.

WAS

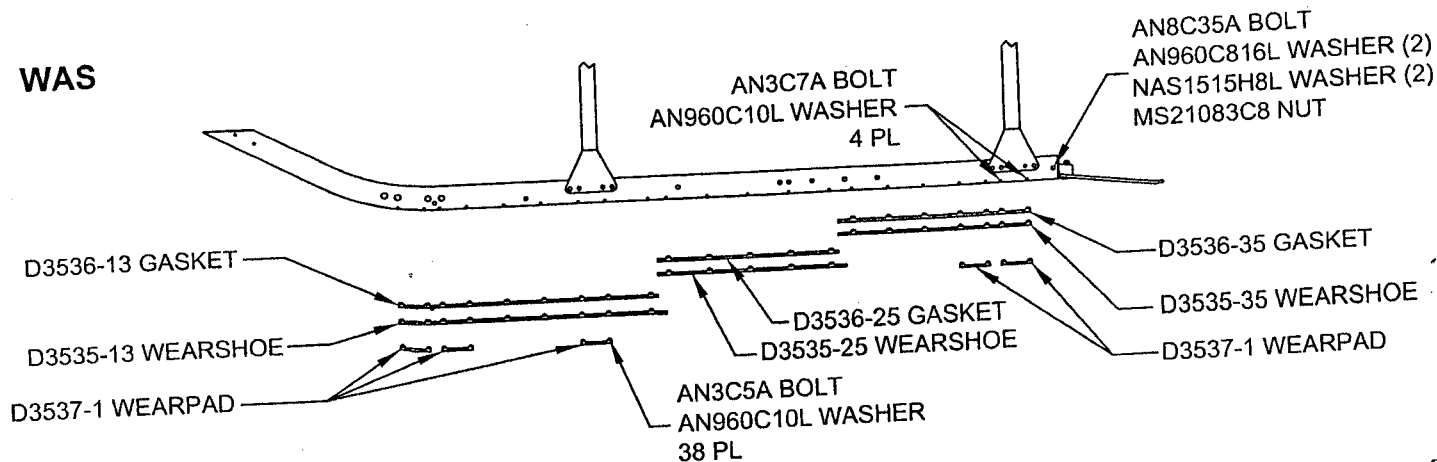

NOW

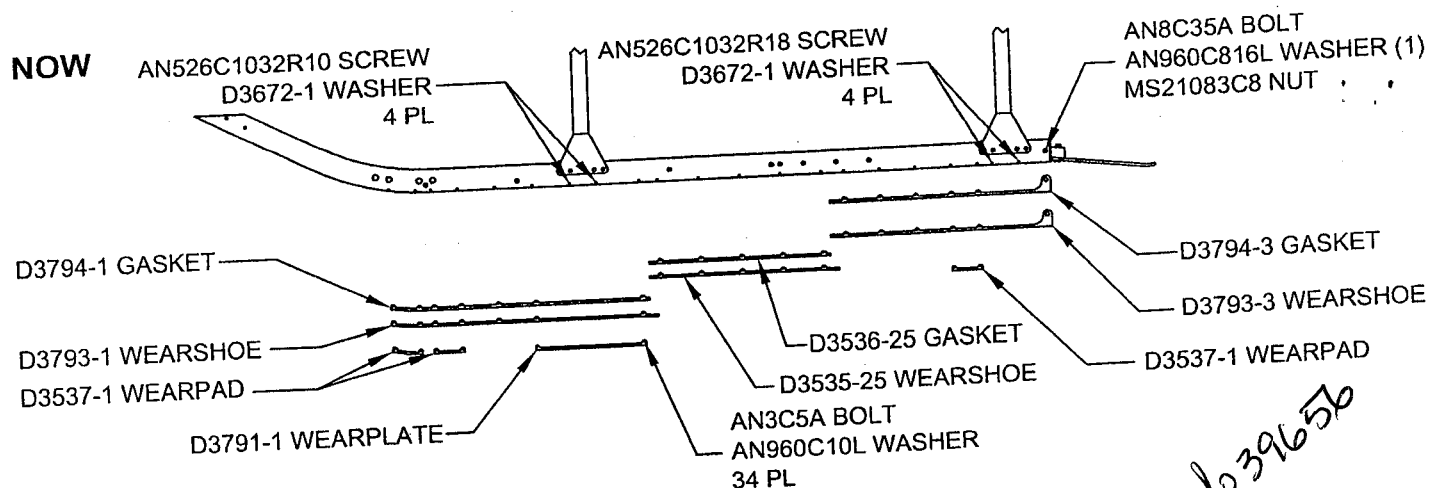

**FIGURE 1 - WEARPLATE MODIFICATION**

(AN526C1032RXX SCREW LOCATIONS NO LONGER USED TO MOUNT WEARSHOES)

A	NEW ISSUE	PH	08.05.14
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE USA, INC</b> PORT HADLOCK, WA	
DRAWN	PH		
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9413	SHEET 1 OF 3
APPROVED		TITLE	SCALE
DE APPR.		WEARSHOE MODIFICATION	NTS
DATE	08.05.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Wb39656

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



**DART****RELEASED**  
07-08-02

DESIGN <i>PH</i>	DRAWN BY <i>CB</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. <b>D2750</b>	REV. E SHEET 1 OF 5
DATE <b>07.05.17</b>		TITLE <b>350 SKIDTUBE ASSEMBLY</b> SCALE NTS	
REV	DATE	DESCRIPTION	
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3 / D2750-4; INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133 / 9157	
E	07.05.17	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY(38) NAS1515H3L; REMOVE QTY(10) NAS1515H8L; REMOVE D2741, QTY(2) AN960C816; REMOVE QTY(2) MS21083C8	

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-13	WEARSHOE
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3535-35	WEARSHOE
1	1	1	1	D3536-13	GASKET
1	1	1	1	D3536-25	GASKET
1	1	1	1	D3536-35	GASKET
5	5	5	5	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
42	42	42	42	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
2	2	2	2	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER
2	2	2	2	NAS1515H8L	WASHER

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. *31654*

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN PH	DRAWN BY CB	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED [Signature]	DRAWING NO. D2750	REV. E SHEET 2 OF 5
DATE 07.05.17		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

GENERAL NOTES:


RELEASED  
07-08-02 [Signature]

1. ALL DIMENSIONS ARE IN INCHES.
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.150 \pm 0.010$  IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.15 \pm 0.030$  IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS C-C, D-D AND F-F.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:  
MINIMUM YIELD TENSILE STRENGTH = 35 ksi  
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:  
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.  
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'F' SIZE HOLES ( $\emptyset 0.297$ ) FOR WEARSHOE INSERTS.
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3C5A/AN3C7A WEARSHOE BOLTS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS POWDER COATING WITH MEK DEGREASER.


SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 39650

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.





THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

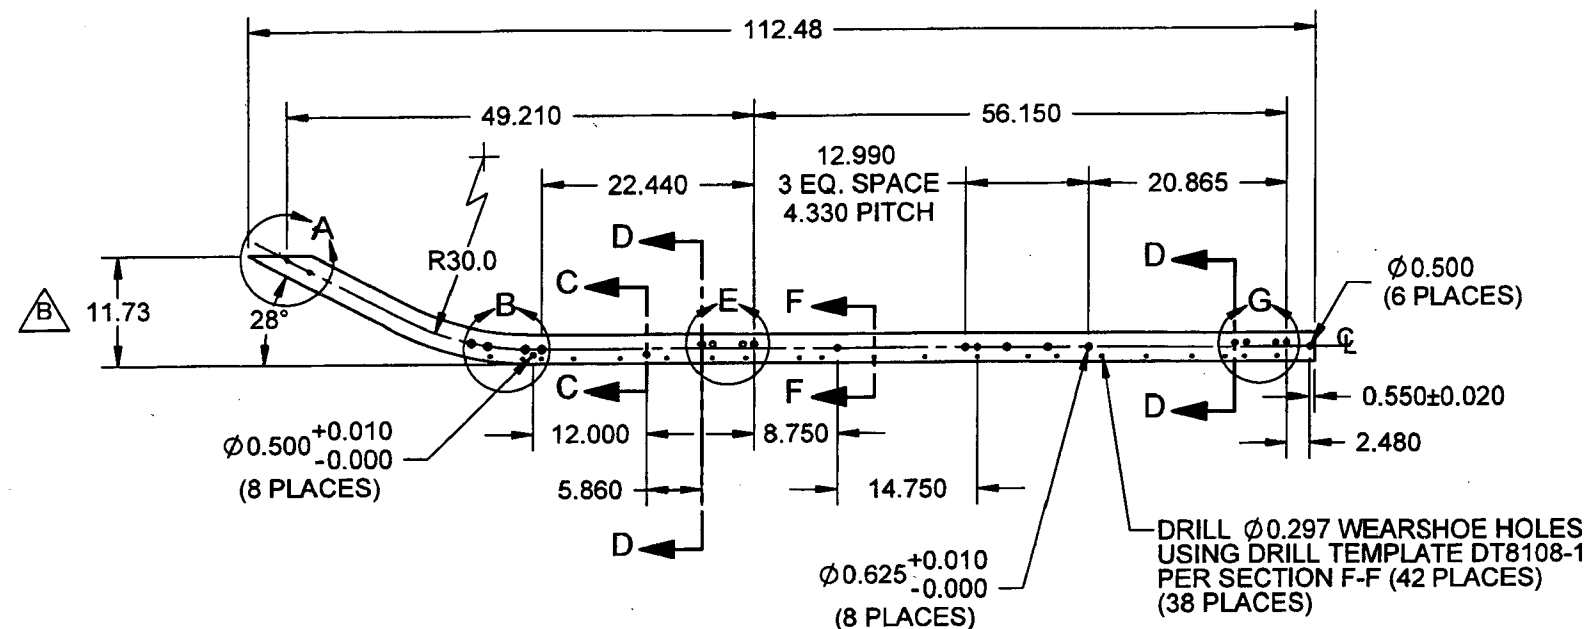


**D2750-1 LH SKIDTUBE (SHOWN)**  
**D2750-2 RH SKIDTUBE (OPPOSITE)**

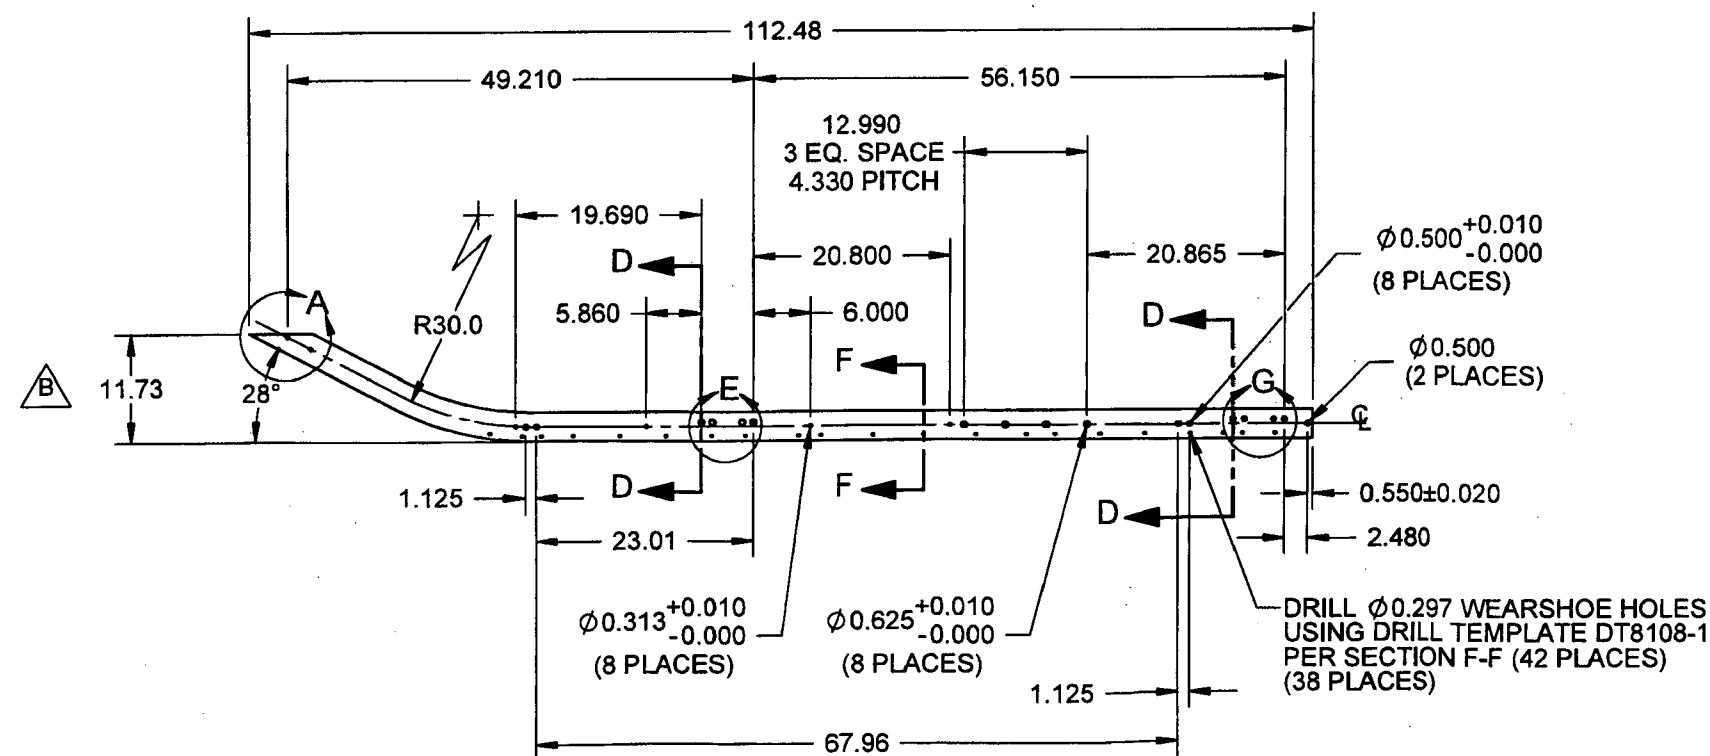


**D2750-3 LH SKIDTUBE (SHOWN)**  
**D2750-4 RH SKIDTUBE (OPPOSITE)**

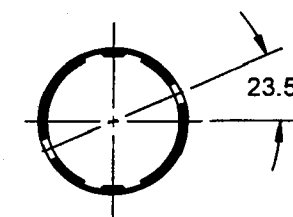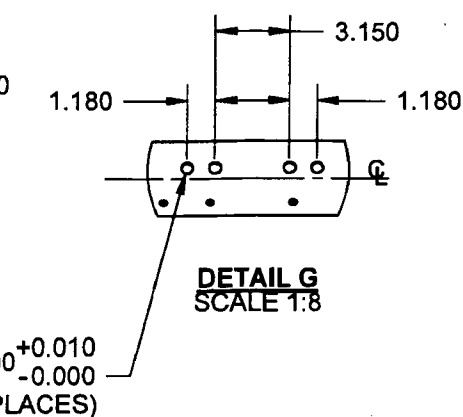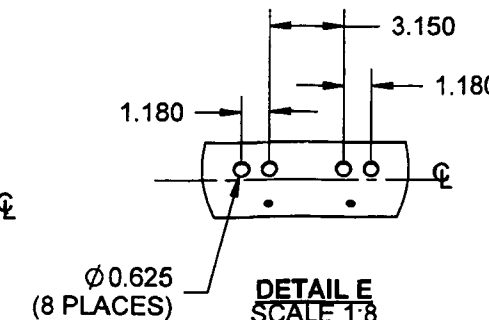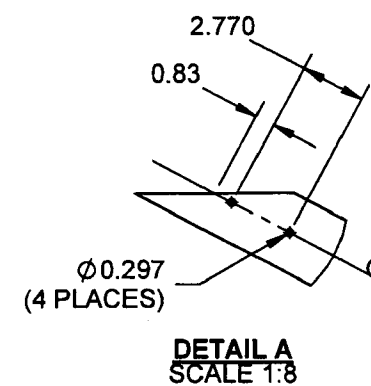


**SECTION C-C**  
**SCALE 1:4**

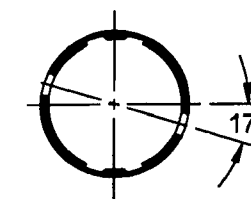

**SECTION D-D**  
**SCALE 1:4**

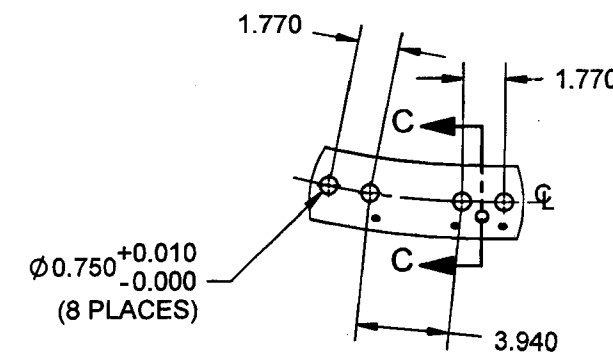

**DETAIL B**  
**SCALE 1:8**  
(ALL DIMENSIONS ARE STRAIGHT LINE DIMENSIONS)

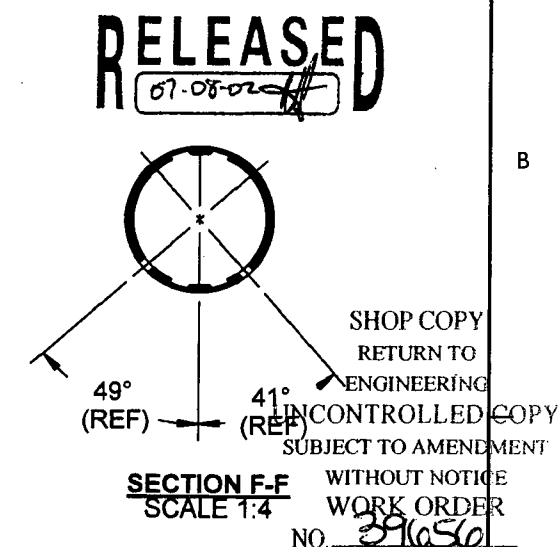

**SECTION F-F**  
**SCALE 1:4**

DESIGN <b>PH</b>	DRAWN BY <b>CB</b>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <b>PH</b>	APPROVED <b>[Signature]</b>	DRAWING NO. <b>D2750</b>	REV. E SHEET 3 OF 5
DATE <b>07.05.17</b>	TITLE <b>350 SKIDTUBE ASSEMBLY</b>		SCALE 1:20
<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>			

**RELEASED**  
07-08-02

SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. **39050**



INSTALL ALS4-1032-225  
INSERTS (4 PLACES)  
AFTER FINISH

D2750-1 (LH) OR  
D2750-2 (RH)

**D2750-041 ASSEMBLY (SHOWN)  
D2750-042 ASSEMBLY (OPPOSITE)**

BLACK ANTI-SKID

BOND D2739 WEB INTO D2750-1 (OR D2750-2)  
OUTER TUBE WITH NON-STRUCTURAL  
SIKAFLEX-241 ADHESIVE PER DART QSI 015.  
NOTE: ENSURE THAT HOLES LINE UP.

INSTALL ALS4-1032-225  
WEARSHOE INSERTS (38 PLACES)  
AFTER FINISH

D3488-041  
(OR D3488-042)

WELDED SPACER  
NOT REQUIRED

NO INSERT

D3535-35  
D3536-35

AN3C7A BOLT (REF)

**RELEASED**  
07.05.17

**DETAIL H  
SCALE 1:5**

**SECTION J-J  
SCALE 1:5**

INSTALL:  
AN3C6A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(4 PLACES)

**SECTION M-M  
SCALE 1:5**

**WELDING INSTRUCTIONS**  
1) CHAMFER HOLE 0.050 x 45°  
2) INSERT D2743 SPACER  
3) WELD INTO PLACE  
4) GRIND WELD FLUSH  
5) DRILL OUT SPACER TO Ø0.484  
6) SPOT FACE Ø0.750 (SECTION P-P ONLY)

**SECTION Q-Q  
SCALE 1:5**

INSTALL:  
AN6C44A BOLT (1)  
D2745 BUSHING (2)  
D3631-1 WASHER (2)  
MS21043-6 NUT (1)  
(4 PLACES)

**SECTION K-K  
(FOR Ø0.750 HOLES ONLY)  
SCALE 1:5**


**WELDING INSTRUCTIONS**  
1) CHAMFER HOLE 0.050 x 45°  
2) INSERT D3490-1 SPACER (4 PLACES) INTO  
Ø0.500 HOLES OR INSERT D3490-3 SPACER  
(4 PLACES) INTO Ø0.750 HOLES  
3) WELD INTO PLACE  
4) GRIND WELD FLUSH  
5) INSERT D3492-041 PLUG ASSEMBLY (8 PLACES)  
INTO D3490-1 SPACER OR INSERT D3492-043  
PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER  
ON BOTH ENDS AFTER FINISH

**SECTION P-P  
SCALE 1:5**

**SECTION R-R  
SCALE 1:5**


INSTALL:  
AN8C35A BOLT (1)  
AN960C816L WASHER (2)  
NAS1515H8L WASHER (2)  
MS21083C8 NUT (1)

**SECTION L-L  
(FOR Ø0.500 HOLES ONLY)  
SCALE 1:5**

DESIGN <b>PH</b>	DRAWN BY <b>CB</b>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <b>PH</b>	APPROVED 	DRAWING NO. <b>D2750</b>	REV. E SHEET 4 OF 5
DATE <b>07.05.17</b>		TITLE <b>350 SKIDTUBE ASSEMBLY</b>	SCALE 1:10
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 39056



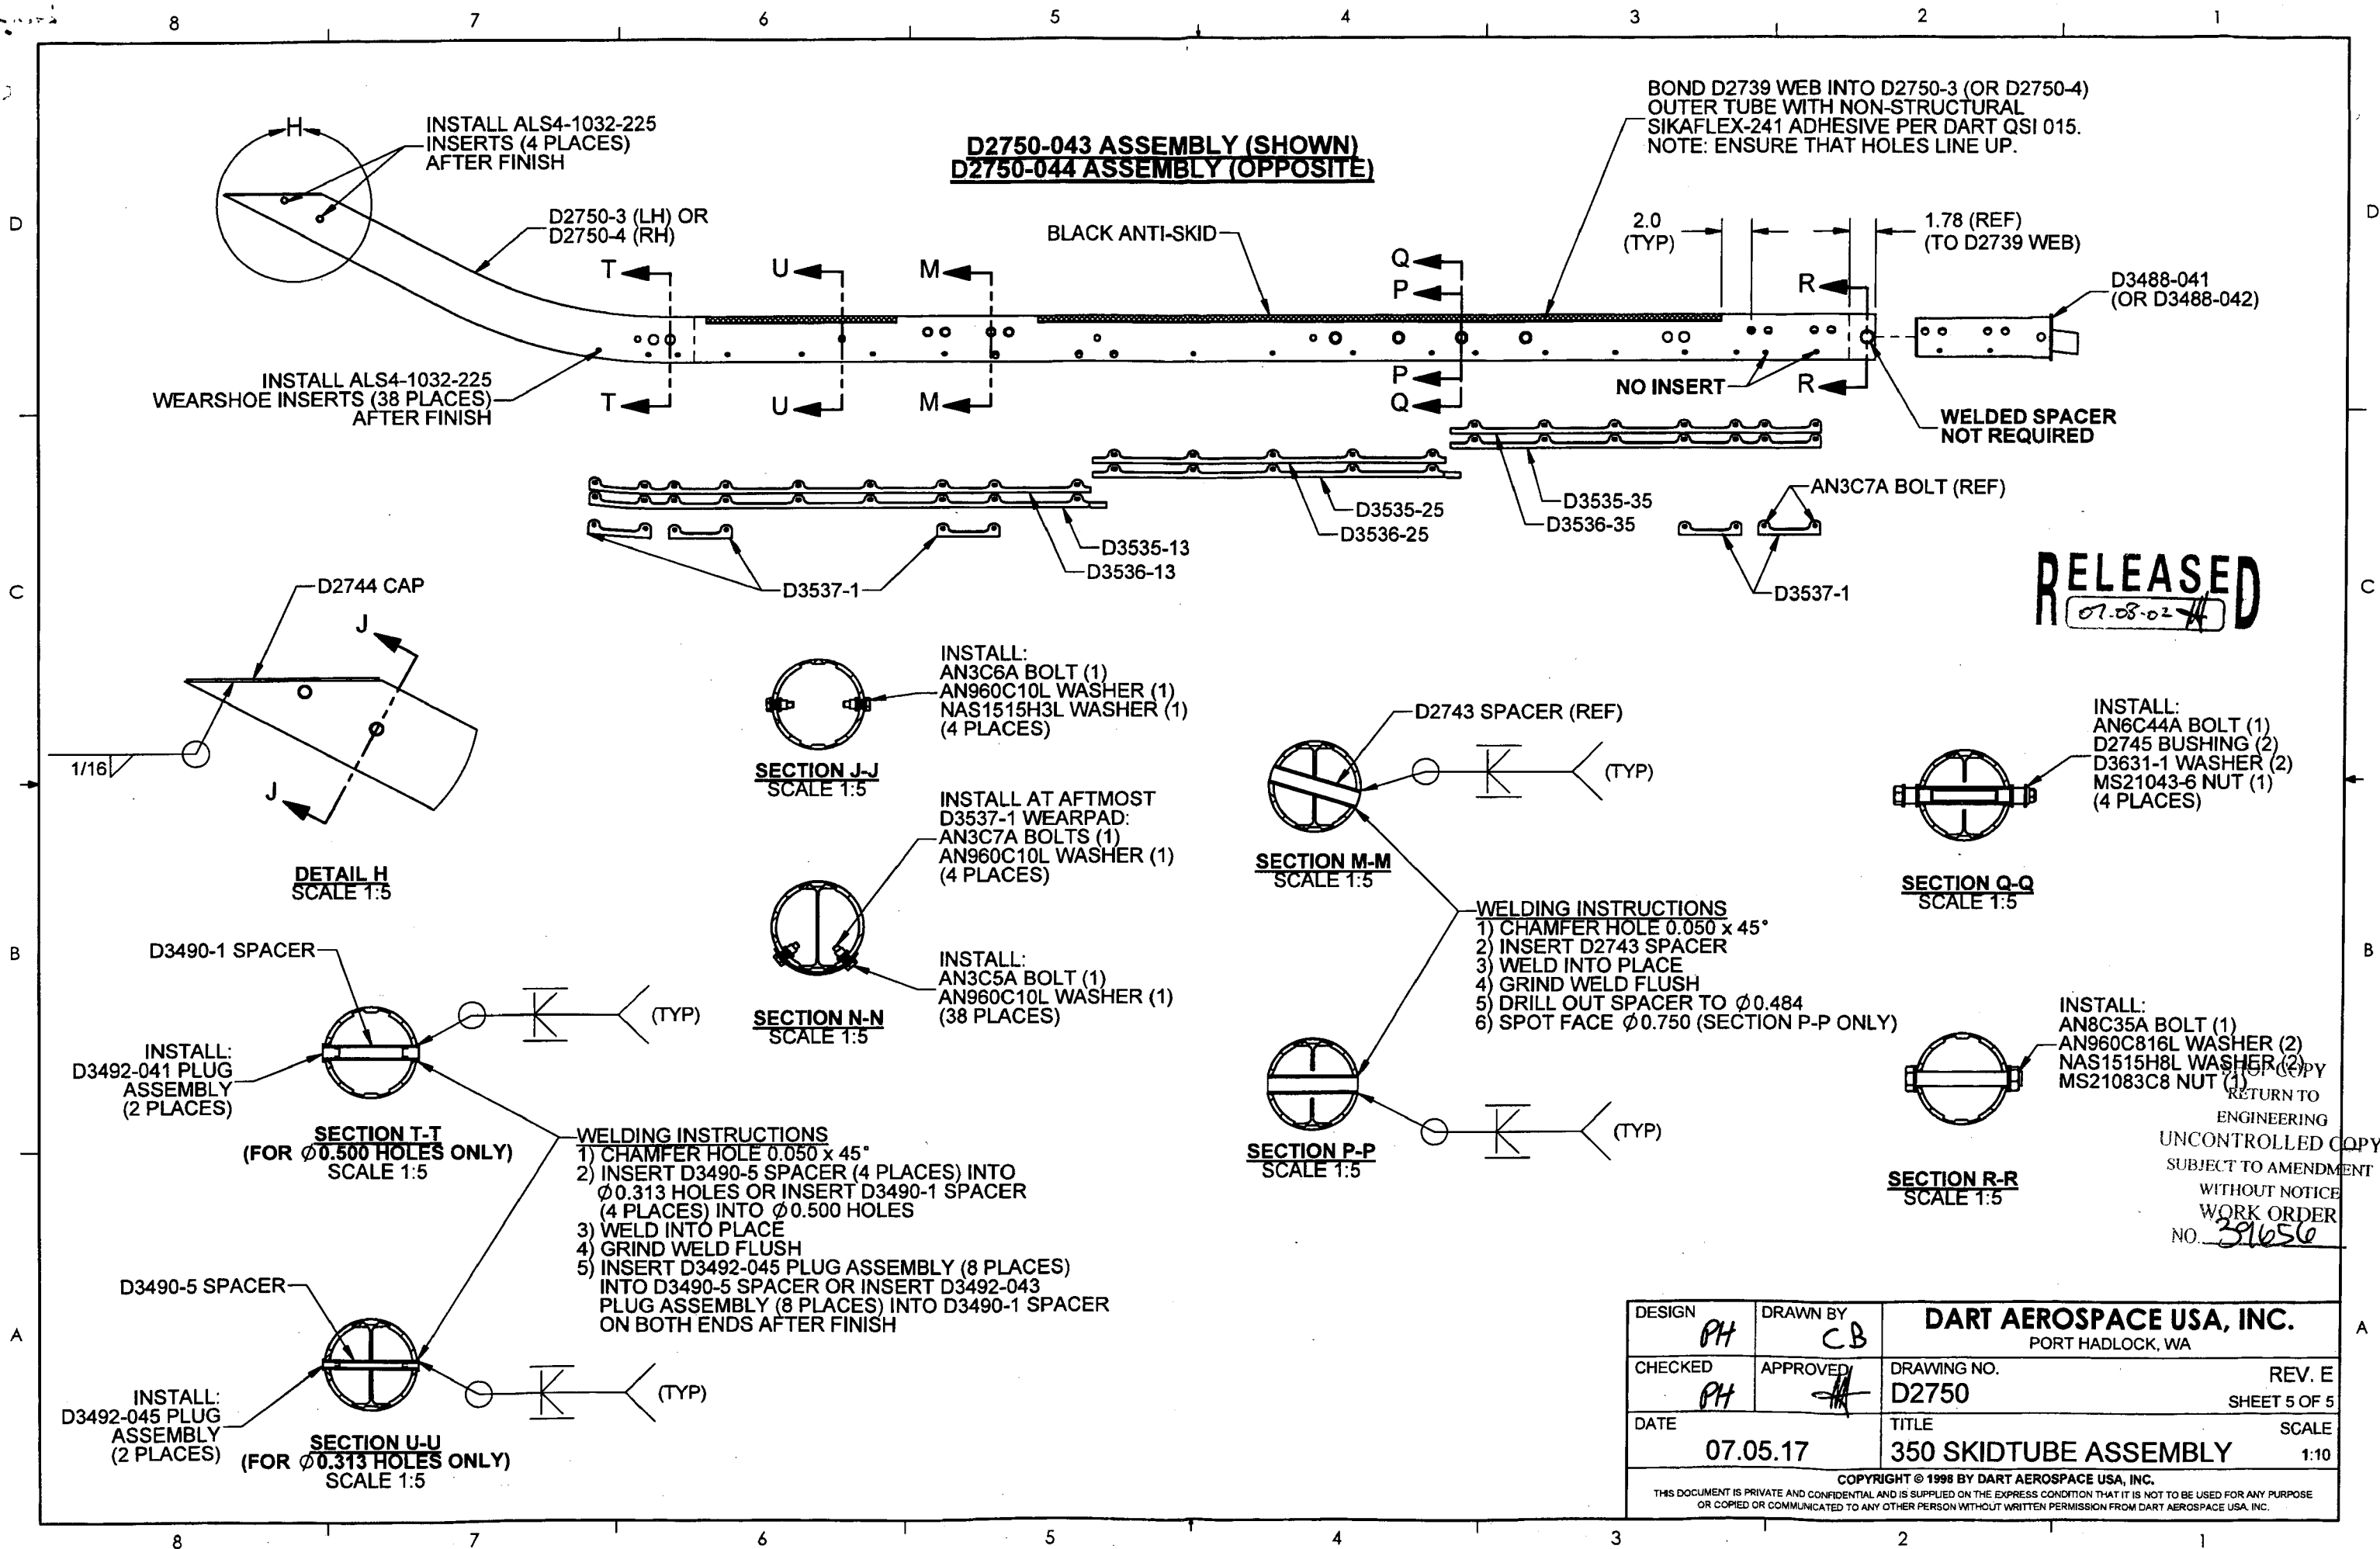





NO. 157

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliot  
Job number: 392301  
Part number: D350 636 012  
Description: 350 skid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminium  
Current: AC[☒] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Penetration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]

UNACCEPTABLE

Cracks:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Undercut:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Pin holes:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Overlap (cold lap)	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Porosity (surface):	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Coloration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]

Qualifier Pat Duval Date of Test Coupon 08-05-23  
Welder Barclay Elliot Date of Test Coupon 08-05-28

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

